

#### SAS Superstructure

Location: 04-SF-80-13.2 / 13.9 Client Name: CalTrans

#### Daily Diary Report by Bid Item

Contract No.: 04-0120F4

Diary #: 483 Const Calendar Day: 553 Date: 09-Dec-2013 Monday Inspector Name: Soheilifard, Saman Title: Transportation Engineer

Inspection Type: Continuous

**Shift Hours:** 07:00 am 05:00 pm **Break:** 00:30 **Over Time:** 02:00

Federal ID: Location:

Reviewer: Awal, Mohammad Approved Date: 30-May-14 Status: Approved

Weather

**Temperature 7 AM** 50 - 60 **12 PM** 50 - 60 **4PM** 

Precipitation none Condition Rain

Working Day 🗸 If no, explain:

Diary:

#### Work description.

Mon, December 9, 2013

The CCC workers have opened a new front in the East Shaft today addressing the rust and areas of damaged or no paint. In our walk through of the East & South shafts with Mr. Ross Stuart, we came across the following items of interest:

- Working to land my next assignment;
- ·Loose clip on the grating at Elev. 53.0m;
- •Missing Bolt on Skin "A" of the East shaft at El. 77.0m;
- •@ El. 56.0m, Skin "C" of the East shaft, Bleyco need to address the abandoned & open drilled & tapped holes:
- •CCC has assigned two painters in the South shaft to Power tool (SP@ &3) at Splice #1;
- •CCC continued with leaving two painters in the East shaft who began their work of power tooling of the rusted steel at El. 74.0m through 71.0m;

I split my time between the paint & Fender operations, albeit not equally, and as such for more details on the paint operation or the summary of Dutra's work before I got to the Tower base, please refer to Ross Staurt and Sami Daouk's reports, respectively.

I was at the base of the Tower at about 13:30 relieving Sami who in my place was watching over Dutra's work up to this point. The following is the summary of events until the close of the business:

- •I was told that Allan Karpieski got injured on Friday after he tripped over some stubs on the barge . The word was that he had not bothered to tell anyone but Gilbert about his injury/departure before leaving the site.
- •At the close of the day, pile #11 is the only pile that remains without a collar and the associated bracing to the adjacent pile:
- •The construction of built-up sections, welding of stiffeners to the false work beams, cutting angles, and in summary all work pertaining to the false work continues on Kelso and EM1106;
- •I heard that Derek, a Ballard diver had to quickly surface from a depth of 70' due to the pinched hose line. He used his spare breathing device to ascend and no complications were reported;
- •I spoke to Sam Patel about the abandoned holes left behind by Bleyco and he indicated that he will address that directly with them and that the items are now on the punch list;

O4-0120F4 Bid Item: 041 0-000-000.041 ERECT PRECAST CONCRETE FENDER MODULES

DUTRA MATERIALS

Labor
Trade Class Name RT Hrs OT Hrs DT Hrs Total Remarks Dispute
Contractor: DUTRA MATERIALS



Page 1 of 5

Run date 22-Nov-14

04-0120F4

04-SF-80-13.2/13.9

Self-Anchored

Suspension Bridge

Time 3:55 PM

ob Name.	94-0120F4 Insp	ector Name: Soheilifard	l, Saman	Diary #: 4	83 Date: 09-Dec	:-2013 Monday	
Piledriver	JNM	Jason Baragan	8.00	2.00 0.00	10.00		
Superviso	r	Dave Lumsden	8.00	2.00 0.00	10.00		
Piledriver	JNM	LUKE HUDSON	8.00	2.00 0.00	10.00		
Piledriver	JNM	WALTER QUINTERO	8.00	2.00 0.00	10.00		
Piledriver	JNM	JEFF SAINZ	8.00	2.00 0.00	10.00		
Piledriver	JNM	JON - PAUL CHENEY	8.00	2.00 0.00	10.00		
Piledriver	APP	ROBERT UTLEY	8.00	2.00 0.00	10.00		
Piledriver	APP	JAMES SAVAGE	8.00	2.00 0.00	10.00		
Operator	OTH	DAVE AVILAS	8.00	2.00 0.00	10.00		
Operator	ОТН	STEVE FRIYER	8.00	2.00 0.00	10.00		
04-0120F4	Bid Item: 04	1 0-000-000.041	ERECT PREC	AST CONCR	ETE FENDER MODI	JLES	
BALLAD DIVIN	G						
Labor							
Trade	Class	Name	RT Hrs OT	Hrs DT Hrs	Total Remarks		Dispute
Contractor:	BALLAD DIVING						
Marine Co	oordinator	DERDK CHASE	8.00	2.00 0.00	10.00		
Marine Co	oordinator	TODD HORNER	8.00	2.00 0.00	10.00		П
Underwate	er Diver	ALEX DOSS	8.00	2.00 0.00	10.00		Π
04-0120F4	Bid Item: 07	78 T-L01-ENE.078	Tower Lift 01	External Pair	nt Tower NE		
<b>04-0120F4</b> CERTIFIED CC	Bid Item: 07		Tower Lift 01	External Pair	nt Tower NE		
			Tower Lift 01	External Paiı	nt Tower NE		
CERTIFIED CC		Υ	Tower Lift 01  Tower Lift 02				
04-0120F4	OATINGS COMPAN	Y 78 T-L02-ENE.078					
04-0120F4 CERTIFIED CO Labor	Bid Item: 07	Y 78 T-L02-ENE.078 Y	Tower Lift 02	External Pair	nt Tower NE		
04-0120F4 CERTIFIED CO Labor Trade	Bid Item: 07 DATINGS COMPAN	Y	Tower Lift 02		nt Tower NE		Dispute
04-0120F4 CERTIFIED CO Labor Trade Contractor:	Bid Item: 07 DATINGS COMPAN  Class CERTIFIED COATI	Y	Tower Lift 02  RT Hrs OT	External Pair	nt Tower NE  Total Remarks		Dispute
04-0120F4 CERTIFIED CO Labor Trade	Bid Item: 07 DATINGS COMPAN  Class CERTIFIED COATH JNM	Y	Tower Lift 02  RT Hrs OT	External Pair	nt Tower NE		Dispute
04-0120F4 CERTIFIED CO Labor Trade Contractor:	Bid Item: 07 DATINGS COMPAN  Class CERTIFIED COATII JNM JNM	Y  78 T-L02-ENE.078  Y  Name  NGS COMPANY	Tower Lift 02  RT Hrs OT  8.00	External Pair	nt Tower NE  Total Remarks		Dispute
04-0120F4 EERTIFIED CC Labor Trade Contractor: Painter	Bid Item: 07 DATINGS COMPAN  Class CERTIFIED COATH JNM	Y  78 T-L02-ENE.078  Y  Name  NGS COMPANY  Hector pana	Tower Lift 02  RT Hrs OT  8.00	External Pair Hrs DT Hrs  0.00 0.00	nt Tower NE  Total Remarks  8.00		Dispute

Attachment



Job Name: 04-0120F4 Inspector Name: Soheilifard, Saman Diary #: 483 Date: 09-Dec-2013 Monday



RustyElevator Connections (4)



RustyElevator Connections (3)



Abandoned Holes Left By Bleyco(1)



Various Fender Falsework tasks (1)



RustyElevator Connections (2)



EL.77.0mPaint Repair

Job Name: 04-0120F4 Inspector Name: Soheilifard, Saman Diary #: 483 Date: 09-Dec-2013 Monday



Various Fender Falsework tasks (2)



Various Fender Falsework tasks (4)



Various Fender Falsework tasks (6)



EL77.0m-Grinding




Abandoned Holes Left By Bleyco(2)



Various Fender Falsework tasks (5)

Job Name: 04-0120F4 Inspector Name: Soheilifard, Saman Diary #: 483 Date: 09-Dec-2013 Monday



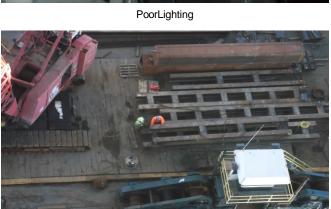

Various Fender Falsework tasks (3)



RustyElevator Connections (1)